
CASE IH 2200/2400/3200/3400 - NEW HOLLAND 96C/96D/98C/98D/996

QD2 STALK STOMPER PARTS LISTING/ASSEMBLY INSTRUCTIONS

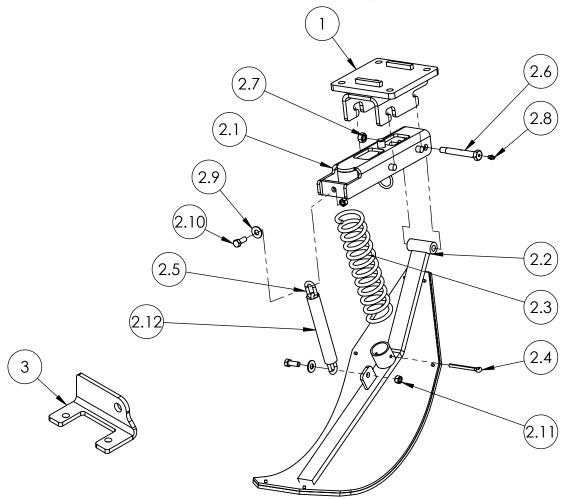

NOTES:

1 Item 3 is optional and not included in the kit, please order separately

2 43016 - 14" Stalk Stalk Shoe Assy

3 41748 - 14" Stalk Stomper Shoe W/Poly

Install Self-Tapping Grease Fitting into end of Pivot Bolt.
Torque grease fitting to 65-70 inch pounds. DO NOT OVERTIGHTEN!

	ITEM #	PART #	DESCRIPTION	QTY				
	1	43008	QD2 HEADER BRACKET	1	ITEM #	PART #	DESCRIPTION	QTY
$\stackrel{\wedge}{2}$	2	43003	STALK STOMPER ASSY 9"	1	2.7	00213	NUT, 7/16"-14 HEX TOP LOCK	1
	2.1	43004	SHOE BRACKET ASSY	1	2.8	01009	GREASE FITTING, 1/4"-28 STRAIGHT	1
$\sqrt{3}$	2.2	41825	STALK STOMPER SHOE W/POLY 9"	1	2.9	00249	WASHER, 3/8" FLAT	2
	2.3	01040	Spring	1	2.10	00104	BOLT, 3/8"-16 X 1" HEX	2
	2.4	00691	PIN, 1/4" X 3" COTTER	1	2.11	00209	NUT, 3/8"-16 HEX	2
	2.5	00931	CHAIN	1	2.12	01046	CHAIN SLEEVE	1
	2.6	01001	BOLT, CUSTOM (GREASEABLE)	1	3	22043	MOUNT BRACKET (OPTIONAL)	



120 Eastgate Drive SE PO Box 7

1-800-788-6483 1-320-587-2322

Hutchinson, MN 55350 1-320-587-6112 (Fax)

WWW.MAYWES.COM

PAGE 1 OF 2 Doc #: 10200_A


CASE IH 2200/2400/3200/3400 - NEW HOLLAND 96C/96D/98C/98D/996 STALK STOMPER INSTALLATION

Safety Procedure:

- Park combine on level ground and engage the parking brake.
- Raise the head and lock in the upright position.
- Support all row units that stalk stompers will be installed on to ensure row units remain stationary during installation.

Installation Procedure:

- Remove the factory gearbox support brackets (Fig. 1). Replace with Header Bracket (43008) positioning the mount plate as pictured below in Figure 2.
- <u>Note:</u> If installing stalk stomper on the same row that the deck plate cylinder is attached; replace the factory mounting bracket with Mount Bracket (22043) which is not included in the kit, please order separately (Fig. 3).
- Lift the Stalk Stomper Assy (43003) into mating features in the Header Bracket (43008). Pull Stalk Stomper Assy back until lock pin assembly snaps into place.

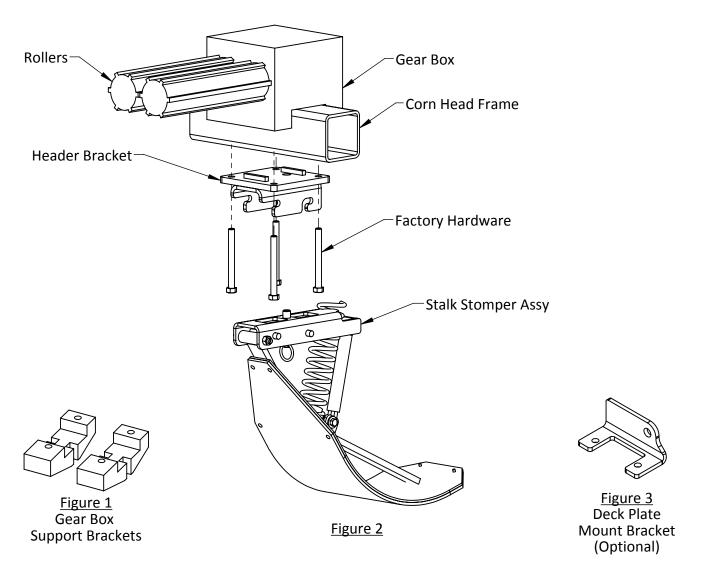



120 Eastgate Drive SE PO Box 7

Hutchinson, MN 55350

1-800-788-6483 1-320-587-2322

1-320-587-6112 (Fax)

WWW.MAYWES.COM

PAGE 2 OF 2 Doc #: 10200_A